

LONGHAND MEMORANDUM

BABCOCK & WILCOX

TO

PHIL TICE, IPSC

FROM

DAVE MANCUSO, B&W Service

CUST.

IPSC

FILE NO. OR REF.

CB-0615

SUBJ.

Burner Settings - UNIT 2

DATE

11/29/88

ALL BURNERS (OUTER REGISTERS, SPIN VANES, BACK PLATES), HAVE BEEN RESET FOLLOWING THE FALL 1988 OVERHAUL.

- EXPANSION JOINTS WERE INSTALLED ON THE OUTER REGISTER DRIVE HANDLES.
- BACKPLATES AND FRONT PLATES OF REGISTERS WERE CUT FREE AND EXPANSION CLIPS WERE INSTALLED

THE BURNER SETTINGS ARE AS FOLLOWS:

OUTER REGISTERS	-	6" (DOOR STIFFENER TO DOOR - ON A PERMANENT BASIS)
SPIN VANES	-	~ 30° (WHERE 90° IS STRAIGHT THRU, 0° IS CLOSED)
BACK PLATES	-	5", 4", 3", 3", 4", 5" OPEN

SPIN VANE, REGISTER, AND BACK PLATE HANDLES WERE REPAINTED AND REMARKED
ALL ADJUSTMENTS HAVE BEEN LOCKED IN PLACE

IF THERE ARE ANY QUESTIONS, PLEASE CONTACT B&W @ x5395

CC: AARON NISSEN

FR: MCGINLEY JR

John Mahalish / Dave Mancuso 11/26^{Sun}-27^{Mon}/88

- 2 spin vanes jammed (working on)

IP7_003317